


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-017	Smoke	8/8/2008	ADS/TM	S07UU_006MH	Dry	Yes	1,554.51

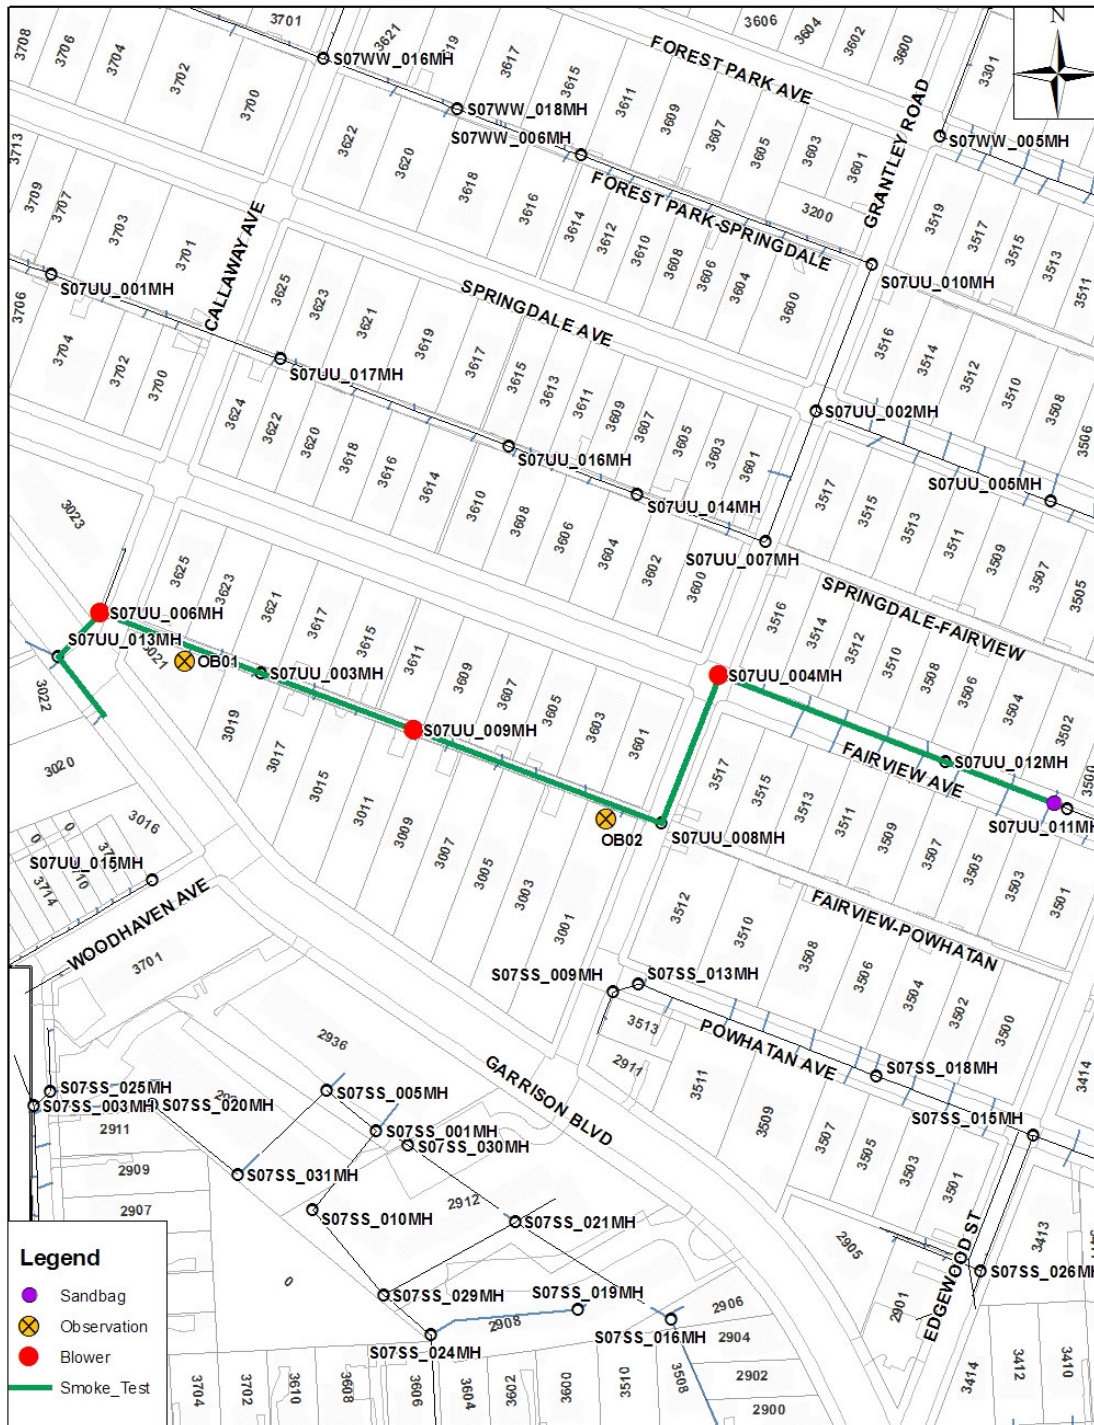

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-017	Smoke	8/8/2008	ADS/TM	S07UU_006MH	Dry	Yes	1,554.51

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S07UU_003G1	S07UU_003MH	S07UU_009MH	201.1461	8
S07UU_004G1	S07UU_004MH	S07UU_012MH	297.5253	8
S07UU_006G1	S07UU_006MH	S07UU_003MH	209.5971	8
S07UU_012G1	S07UU_012MH	S07UU_011MH	159.7288	8
S07UU_008G1	S07UU_008MH	S07UU_004MH	194.0374	8
S07UU_009G1	S07UU_009MH	S07UU_008MH	323.6833	8
S07UU_020G1	S07UU_020DE	S07UU_013MH	93.84655	8
S07UU_013G1	S07UU_013MH	S07UU_006MH	74.94560	8

Observations & Photos

Obs_ID S1028-017-OB01

Address 3021 Garrison Blvd

Status Private

Source Cleanout

Location Yard - back

Nearest MH S07UU_006MH

Comments Smoke from cleanout in back yard. 3021 Garrison Blvd.



Picture \S1028-017-OB01-P01.jpg

Comments Back of house, 3021 Garrison Blvd.

Obs_ID S1028-017-OB02

Address 3001 Garrison Blvd

Status Private

Source Cleanout

Location Yard - back

Nearest MH S07UU_008MH

Comments Smoke from cleanout in back yard. 3001 Garrison Blvd.



Picture \S1028-017-OB02-P01.jpg

Comments Back of house, 3001 Garrison Blvd.